




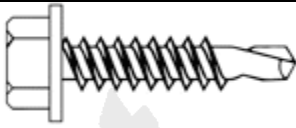


Knoxville Bolt and Screw, Inc.  
 Phone 865-573-1991  
 Fax 865-573-8617

[www.knoxvillebolt.com](http://www.knoxvillebolt.com)  
 800-231-3309  
 800-231-9566

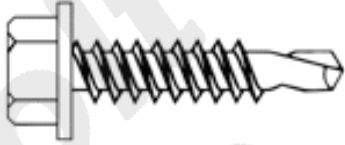

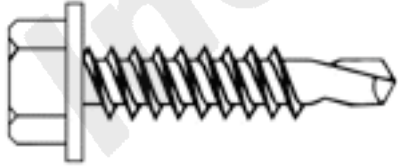

### Unslotted Indented Hex Washer Head Zinc Plated

Size	Point	Recommendations	Picture (Not to a particular size)
6-20 x 3/8 6-20 x 1/2 6-20 x 5/8 6-20 x 3/4	2	Recommended Drive Speed 2500 RPM. Attaches metal to metal. 20 to 18 gauge or thinner. 0.035 - 0.090	
8-18 x 1/2 8-18 x 5/8 8-18 x 3/4 8-18 x 1 8-18 x 1-1/4 8-18 x 1-1/2 8-18 x 2	2	Recommended Drive Speed 2500 RPM. Attaches metal to metal. 22 to 15 gauge or thinner. 0.035 - 0.100	
10-16 x 1/2 10-16 x 5/8 10-16 x 3/4 10-16 x 1 10-16 x 1-1/4 10-16 x 1-1/2 10-16 x 2 10-16 x 3	2-3	Recommended Drive Speed 2250 RPM. Attaches metal to metal. 24 to 12 gauge or thinner. 0.035 - 0.110 #2 pt 0.035 - 0.176 #3 pt	
12-14 x 3/4 12-14 x 1 12-14 x 1-1/4 12-14 x 1-1/2 12-14 x 2 12-14 x 2-1/2 12-14 x 3 12-14 x 4	3	Recommended Drive Speed 2000 RPM. Attaches metal to metal. 20 to 12 gauge or thinner. 0.110 - 0.210	
14-14 x 3/4 14-14 x 1 14-14 x 1-1/4 14-14 x 1-1/2 14-14 x 1-3/4 14-14 x 2 14-14 x 2-1/2 14-14 x 3 14-14 x 4 14-14 x 4-1/2 14-14 x 5 14-14 x 6	3	Recommended Drive Speed 1750 RPM. Attaches metal to metal. 18 to 8 gauge or thinner. 0.110 - 0.230	
14-10 x 7/8 #12HD	1	Lap/Stitching #12 Head 0.090 Max	
12-24 x 7/8 12-24 x 1-1/4 12-14 x 1-1/2 12-24 x 2	4-5	Recommended Drive Speed 1500 RPM. Attaches metal to metal to 1/4-3/8 Steel or less.	

Knoxville Bolt and Screw, Inc.  
 Phone 865-573-1991  
 Fax 865-573-8617

[www.knoxvillebolt.com](http://www.knoxvillebolt.com)  
 800-231-3309  
 800-231-9566

**Unslotted Indented Hex Washer Head Paivated Waxed**

Size	Point	Recommendations	Picture (Not to a particular size)
8-18 x 1/2 8-18 x 3/4 8-18 x 1	2	Recommended drive speed 2500 RPM. Attaches metal to metal. 22 to 15 gauge or thinner. 0.035 - 0.100	
10-16 x 1/2 10-16 x 3/4 10-16 x 1 10-16 x 1-1/4 10-16 x 1-1/2	2-3	Recommended drive speed 2250 RPM. Attaches metal to metal. 24 to 12 gauge or thinner. 0.035 - 0.110 #2 pt 0.035 - 0.176 #3 pt	
12-14 x 3/4 12-14 x 1 12-14 x 1-1/4 12-14 x 1-1/2 12-14 x 2	3	Recommended drive speed 2000 RPM. Attaches metal to metal. 20 to 12 gauge or thinner. 0.110 - 0.210	
14-14 x 3/4 14-14 x 1 14-14 x 1-1/4 14-14 x 1-1/2 14-14 x 2 14-14 x 2-1/2 14-14 x 3 14-14 x 4 14-14 x 5 14-14 x 6	3	Recommended drive speed 1750 RPM. Attaches metal to metal. 18 to 8 gauge or thinner. 0.110 - 0.230	
14-10 x 7/8 #12HD	1		
12-24 x 1-1/4	5		